

396-4107Y1 John Deere 1770/1775 24R30 200 Gal Tank Bulk Fill/Row Box Wing Mounting Instructions

Planter Manufacturer: JOHN DEERE


Kit Number: 530-01-550650 John Deere 1770/1775 24R30 Bulk Fill Elliptical Tank Kit





Kit Number: 530-01-550625 John Deere 1770/1775 24R30 Row Box Elliptical Tank Kit

Kit Number: 530-01-550600 John Deere 1770/1775 24R30 Wing Mount Horizontal Tank

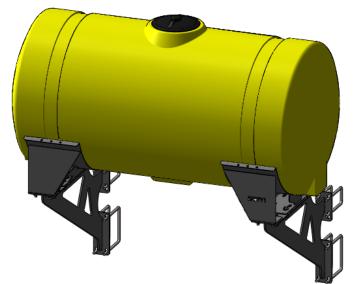

Revised: 3/20/2024



SurePoint Ag Systems Fertilizer Tank Safety and Warnings



SurePoint Ag Systems <u>does not</u> recommend transporting your implement with full fertilizer tanks. Doing so can result in damage to brackets and implement.



Remember to wear proper PPE (*Personal Protective Equipment*) when installing SurePoint Ag Systems fertilizer tank kits. Proper PPE includes gloves, foot and eye protection, and hearing protection.


SurePoint Ag Systems fertilizer application systems require winterization when not in use. Refer to your product manual for winterization procedures.

Failure to follow the above warnings can result in personal injury, damage to your SurePoint Ag Systems products, and damage to your implement.



Parts List and Exploded View 530-01-550600


ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	300-080108-5	1/2" x 1-1/2" Hex Head Bolt G5	32
2	323-08	1/2" Flange Nut	32
3	330-08	1/2" Flat Washer	32
4	380-1001	1/2" U-Bolt Kit - Fits 7" x 7" tube - Includes Flange Nuts	8
5	380-1034	1/2" U-Bolt Kit - Fits 3" x 7" tube - Includes Flange Nuts	8
6	420-2507Y1	Tank Saddle Weld Assembly for 32" Tanks	4
7	420-4596Y1	SurePoint Ag 24 Row Wing Tank Bracket	4
8	525-2055	2" Tank Strap Kit	4
9	727-02-HZ0200-32-Y	200 Gal Horizontal Tank - Yellow	2

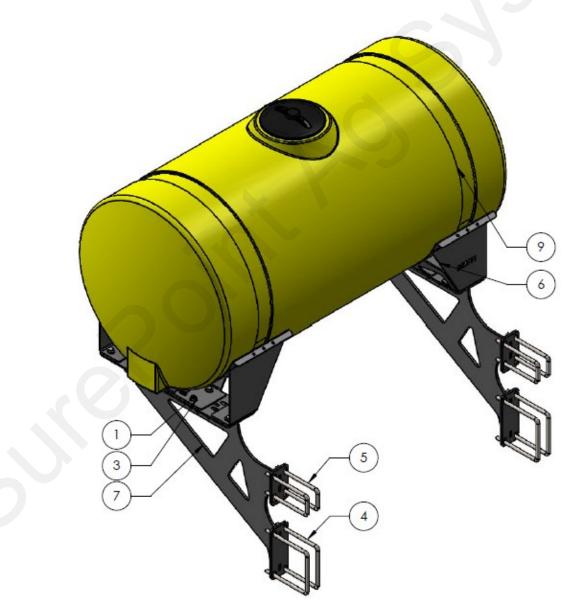



Parts List and Exploded View 530-01-550625


ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	525-2055	2" Tank Strap Kit	4
2	420-4694Y1	200 Gal Elliptical Saddle	4
3	727-01-HE0200-41-Y	Elliptical Tank - 200 Gal - Yellow	2
4	330-08	1/2" Flat Washer	32
5	300-080108-5	1/2" x 1-1/2" Hex Head Bolt G5	32
6	323-08	1/2" Flange Nut	32
7	380-1001	1/2" U-Bolt Kit - Fits 7" x 7" tube - Includes Flange Nuts	8
8	380-1034	1/2" U-Bolt Kit - Fits 3" x 7" tube - Includes Flange Nuts	8
9	420-4600Y1	SurePoint Ag 24R Wing Tank - Row Box Tank Bracket	4

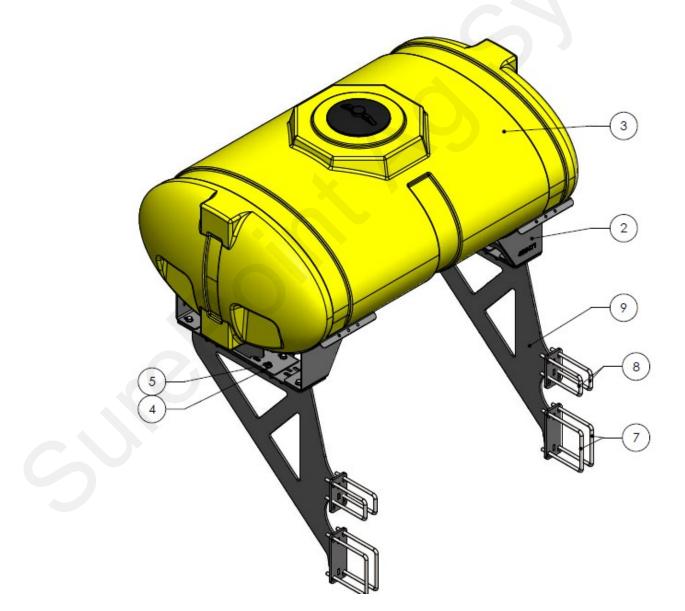



Parts List and Exploded View 530-01-550650


ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	330-08	1/2" Flat Washer	16
2	525-2055	2" Tank Strap Kit	2
3	420-4694Y1	200 Gal Elliptical Saddle	2
4	727-01-HE0200-41-Y	Elliptical Tank - 200 Gal - Yellow	1
5	420-4596Y1	SurePoint Ag 24R Wing Tank Bracket	2
6	300-080108-5	1/2" x 1-1/2" Hex Head Bolt G5	16
7	323-08	1/2" Flange Nut	16
8	380-1001	1/2" U-Bolt Kit - Fits 7" x 7" tube - Includes Flange Nuts	4
9	380-1034	1/2" U-Bolt Kit - Fits 3" x 7" tube - Includes Flange Nuts	1

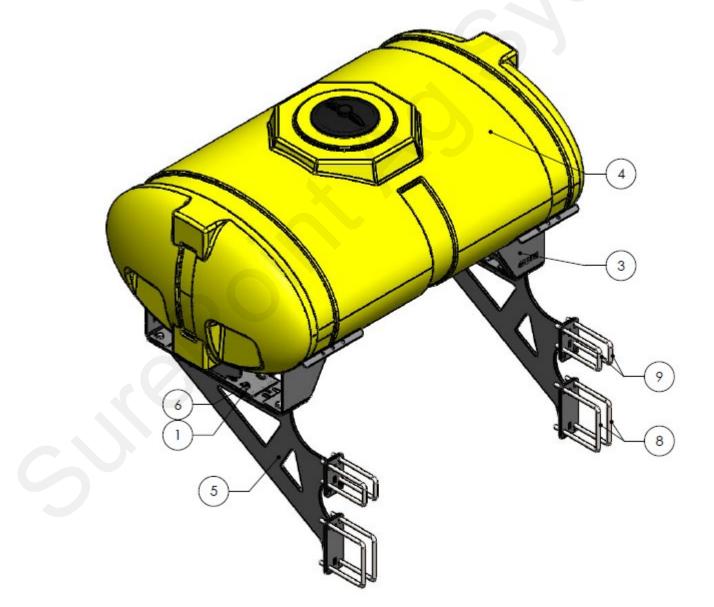

Step by Step Instructions



- 1. Loosely fasten support bracket to 7"x7" toolbar with provided U-bolts (420-4600Y1 for Row Box, 420-4596 for Bulk Fill).
- 2. Loosen 3/4" bolts on hydraulic bracket and move it towards the inside of the planter.
- 3. Use 3" x 7" U-bolts to fasten bracket to top 3"x7" toolbar.
- 4. Set tank saddles on top of support and use eight (8) 1/2" x 1-1/2" bolts to secure saddle in place. (Saddles can be mounted either direction to provide mounting flexibility from obstructions.)
- 5. Set tank in saddles and adjust as necessary. Route hoses through slots in support brackets.
- 6. Tighten all bolts and strap tank in place.
- 7. Check for clearance issues when folding planter for the first time.

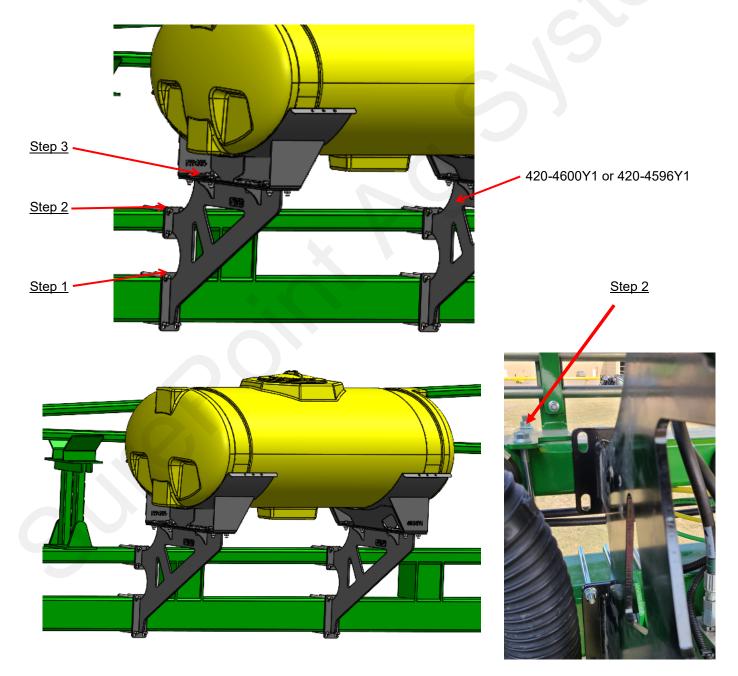

396-4107Y1 - JD 1775 24R30 Wing Tank Mounting Instructions

Page 6 © 2020-2024 SurePoint Ag Systems, Inc.