


396-5178Y1 3 Tank Fill Kit Installation Instructions

Kit Number: 520-00-103100


Kit Description: 3 Tank Fill Manifold and Hose Kit



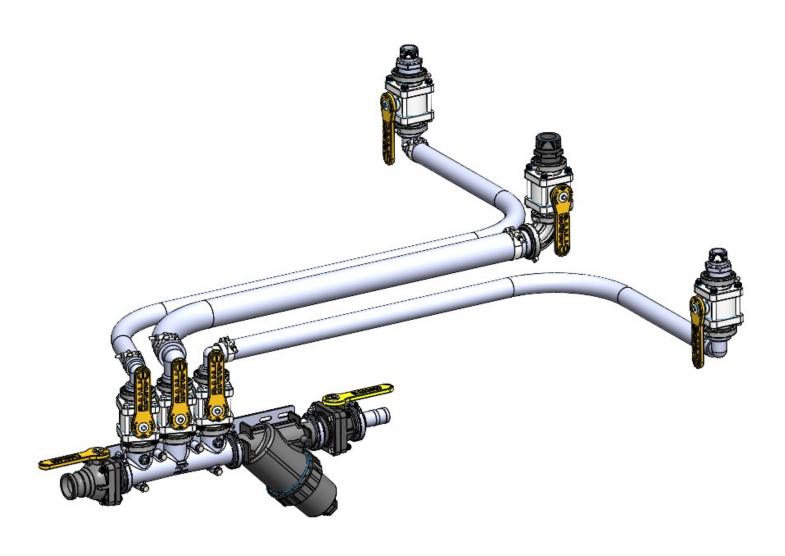

Parts List and Exploded View


ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	102-200MVCF	2" Manifold Standard Port Poly Valve	6
2	102-220MVSCF	2" Manifold Stubby Full Port Poly Valve	1
3	102-220MVSFFP	220 Series Manifold x 2" Male Quick Coupler Full Port Poly Valve	1
4	105-150G	1-1/2" EPDM Gasket	13
5	105-200125MPT	2" Manifold x 1-1/4" MPT	2
6	105-200150BRB90	2" Manifold x 1-1/2" HB - 90 Degree	4
7	105-200BRB	2" Manifold x 2" HB	1
8	105-200BRB90	2" Manifold x 2" HB - 90 Degree	1
9	105-200G	2" EPDM Manifold Gasket for 220 Series Manifold Fittings	4
10	105-200MPT	2" Manifold x 2" MPT	1
11	105-200SWP90	2" Manifold Sweep - 90 Degree	1
12	105-220150BRB	2" Full Port Manifold x 1-1/2" HB	1
13	105-220200EXT	KZ 3-Section, 2" Standard Port Manifold x 2" Full Port Manifold Inlet/Outlet	1
14	105-FC200	2" Manifold Clamp	13
15	105-FC220	2" Full Port Manifold Clamp	4
16	109-220MLS-20	2" 220 Series Manifold Y Strainer - 20 Mesh	1
17	280-150-ENF	1-1/2" Enforcer Fertilizer Solution Hose	30
18	280-200-ENF	2" Enforcer Fertilizer Solutions Hose	15
19	300-060400-5	3/8" x 4" Hex Head Bolt - G5	4
20	321-06-SS	3/8" Nylock Nut - SS	4
21	330-06	3/8" Flat Washer	8
22	350-TC181	T-Bolt Hose Clamp - 1.81 - 2.06" Diameter	4
23	350-TC231	T-Bolt Hose Clamp - 2.31 - 2.62" Diameter	2
24	400-5117Y1	Fill Kit Bracket for 3 Tank Manifold	1

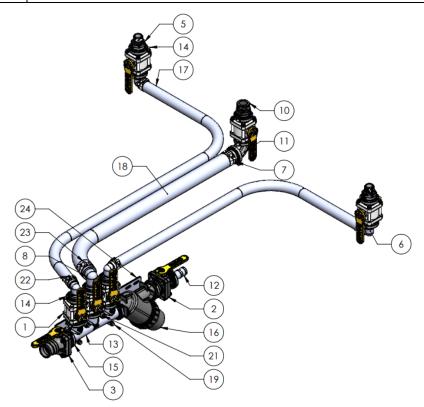

Page 2 © 2021 SureFire Ag Systems, Inc.



Parts List and Exploded View

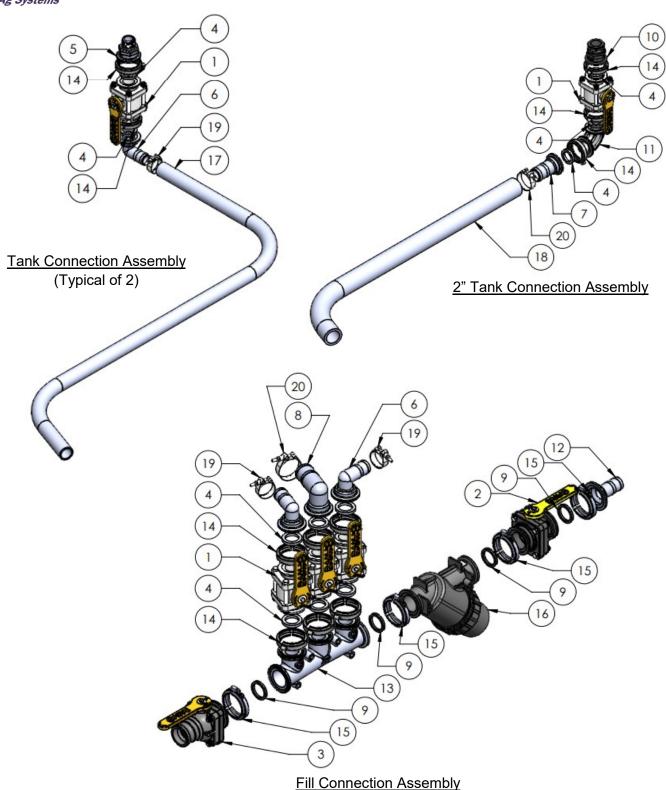





Step by Step Instructions

 Assemble fill kit strainer assembly as shown, using manifold clamps and gaskets.


Note: Angle valves slightly to allow clearance of handles

- 2. Thread desired Manifold x MPT fitting into tank.
- Assemble tank connection assembly as shown, using manifold clamps and gaskets.
- Route 1-1/2" hose from strainer assembly hose barb to tank connection assembly hose barb. Tighten with clamps. Repeat steps 3 and 4 for second 105-200150BRB90.
- 5. Thread desired Manifold x MPT fitting into 3rd tank.
- Assemble 2" tank connection assembly as shown, using manifold clamps and gaskets.
- 7. Route 2" hose from strainer assembly hose barb to 2" tank connection hose barb. Tighten with clamps.

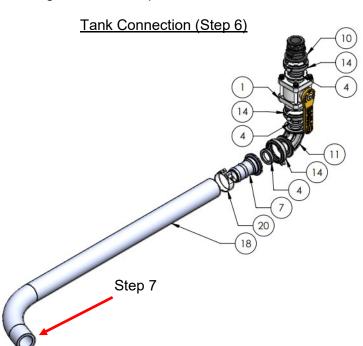

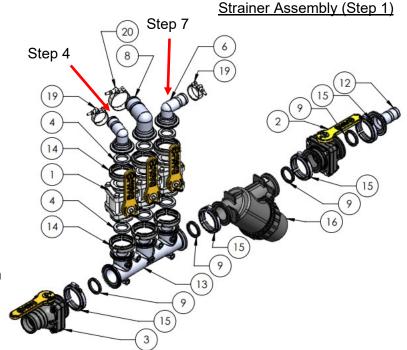

Tank Connection (Step 3)

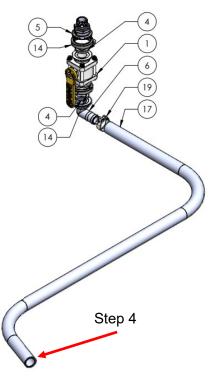

396-5178Y1 - 3 Tank Fill Kit Installation Instructions Manual

Page 4 © 2021 SureFire Ag Systems, Inc.



Step by Step Instructions

- 8. Mount 400-5117Y1 to 102-220MVSFFP valve as shown, by disassembling valve and using its hardware.
- 9. Secure the bracket to 105-220200EXT as shown, using four (4) 3/8" x 4" hex head bolts, nylock nuts, and washers.

